

SONY.

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-900

No. 326

Subject: No Display/No Backlighting.

Date: July 25, 1994

Symptom:

(13)

The unit does not have any display and/or backlighting.

Solution:

1- Check Q603 and Q607 on the Main board and replace them if they are found to be defective.


2- Install a spacer on the B side of the Reset board as shown below. The spacer prevents the B+ pattern from shorting to the metal chassis.

REF	DESCRIPTION	PART NUMBER
-	SPACER	3-892-163-11

Applicable serial number range*: 10,001 - 10,660

* Most of the units within the applicable serial number range have already had the spacer installed prior to shipment.

RESET BOARD

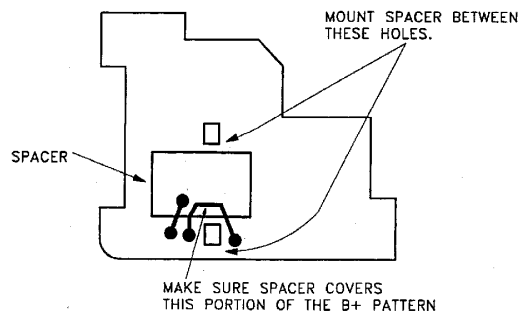

Reference: ME QA FAX QM-APR5-001
Autoflagged - YES

PRINTED IN USA