

SONY.

Car Stereo
Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-U8000

No. 335


Subject: Preventing Damage To Flex Cables.

Date: August 17, 1994

Symptom:
(51)

The shield plate mounted on the Main board may contact the flex cables between the Main board and the RF board, causing the cables to be damaged.

Solution: Add tape to the shield plate as shown below.

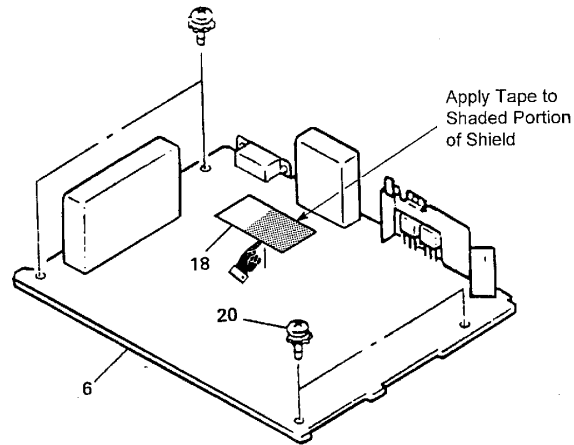

Reference: FPR O1763, P1939
Autoflagged - YES

PRINTED IN USA