

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: MDX-U1

No. 341

Subject: Skipping Or Will Not Read Discs Due To Road
Induced Vibrations.

Date: November 18, 1994

Symptom:
(51)

Road vibrations cause the unit to skip, or in some instances may cause the disc to be ejected, with the word "ERROR" appearing on the display.

Solution:

This problem may be caused by early versions of MD boards. If the customer complains of this problem, identify the version of IC514 mounted on the MD board. If the version is less than "uPD78136GF-**031**-3B9" replace the MD board. The new MD boards have the same part number as the originals, but are mounted with the improved version of IC514.

If the customer's unit already contains version "uPD78136GF-031-3B9", use standard troubleshooting methods to correct the problem.

Note 1: The boards being shipped from the National Parts Center are not factory adjusted, and therefore must have all adjustments performed as shown in the service manual.

Note 2: The original MD board cannot be upgraded by changing IC514 to the improved version.

REF	DESCRIPTION	PART NUMBER
201	MD BOARD, COMPLETE	A-3222-496-A

Applicable Serial Numbers: up to 16,500



Filename: CAR0341.SB
Directory: J:\SBDOC\NOV94
Template: C:\WINWORD\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 11/18/94 2:46 PM
Revision Number: 2
Last Saved On: 11/18/94 2:46 PM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 0 Minutes
Last Printed On: 04/01/96 10:01 AM
As of Last Complete Printing
Number of Pages: 2
Number of Words: 228 (approx.)
Number of Characters: 1,303 (approx.)