

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: MDX-100

No. 342

Subject: Skipping And/Or Same Portion Of Music Is
Continuously Repeated.

Date: November 18, 1994

Symptom:
(57)

The unit skips, or the same portion of the music may be continuously repeated.

Solution: If the customer complains of these symptoms, implement the changes shown below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
-	-	-	RETAINER	3-916-086-01
R501	RESISTOR, 100K	1-216-845-11	RESISTOR, 47K	1-216-841-11
R503, R504	RESISTOR, 200K	1-220-372-11	RESISTOR, 180K	1-216-848-11

Applicable Serial Numbers: 13,801 ~ 14,300

Procedure

- 1- Remove and discard the retainer which secures the flex cable to the optical pickup block.
- 2- Clean the area from which the retainer was removed with alcohol.
- 3- Install the new retainer which includes a lead wire.
- 4- Secure the lead wire with a small amount of glue as shown. **Be sure to keep the height of the glue droplet to 1 mm or less.**
- 5- Dress the lead wire snugly along the top of the optical pickup block and down the side as shown.
- 6- Solder the lead wire to the laser ground trace on the flex cable as shown.



Filename: CAR0342.SB
Directory: J:\SBDOC\NOV94
Template: C:\WINWORD\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 11/18/94 2:14 PM
Revision Number: 2
Last Saved On: 11/18/94 2:14 PM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 2 Minutes
Last Printed On: 04/01/96 10:01 AM
As of Last Complete Printing
Number of Pages: 3
Number of Words: 244 (approx.)
Number of Characters: 1,392 (approx.)