

# Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** XR-U500/U700/U800

**No.** 343

**Subject:** Switching Noise Heard From Speakers While  
Volume Is Being Increased Or Decreased.

**Date:** November 18, 1994


**Symptom:**

(54)

Switching noise may be heard from the speakers while the volume level is being increased or decreased. The noise is particularly noticeable when high power amplifiers or high efficiency speakers are connected to the unit.

**Solution:**

If the customer complains of this problem, remove R126, R128, R226, and R228 from the Main board. On XR-U800, also remove R151 and R251.

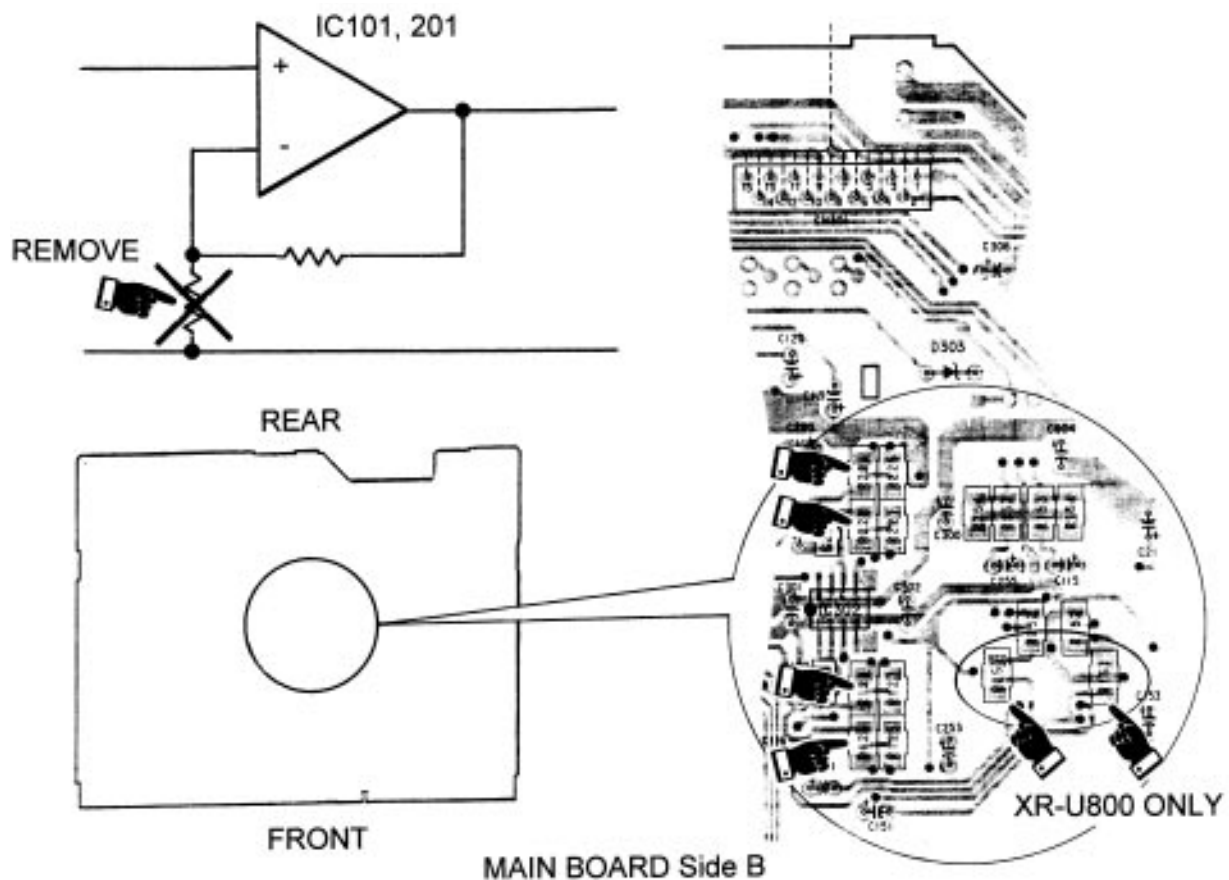



Filename: CAR0343.SB  
Directory: J:\SBDOC\NOV94  
Template: C:\WINWORD\S\_BULL.DOT  
Title:  
Subject:  
Author: Hoyt Wing Lee  
Keywords:  
Comments:  
Creation Date: 11/18/94 2:42 PM  
Revision Number: 2  
Last Saved On: 11/18/94 2:42 PM  
Last Saved By: Hoyt Wing Lee  
Total Editing Time: 1 Minute  
Last Printed On: 04/01/96 10:02 AM  
As of Last Complete Printing  
Number of Pages: 2  
Number of Words: 141 (approx.)  
Number of Characters: 809 (approx.)