

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-900/5060/5070/5260/5270/5460/
5470; EXCD-60

No. 345

Subject: No Loading Or Eject

Date: December 27, 1994

Symptom:
(62)

Discs may not load or eject.

Solution:

This problem may be caused by the ST lever becoming dis-engaged from the sliding arm mounted on the mechanism top cover. If this is the case, replace the mechanism right side parts with the improved parts kit shown below.

REF	DESCRIPTION	PART NUMBER
-	CHASSIS (R) ASSY.	A-3252-581-A

Applicable serial numbers:

CDX-900	up to 11,464
CDX-5060	up to 180,400
CDX-5070	up to 91,900
CDX-5260	up to 153,600
CDX-5270	up to 63,300
CDX-5460	up to 75,600
CDX- 5470	up to 38, 784
EXCD-60	up to 39,892



