

# Car Stereo Service Bulletin

**CSA-14**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** GEN-CAR

**No.** 346

**Subject:** Preventing Recurring Damage To Tuner Pack.

**Date:** December 27, 1994

**Symptom:**  
(21)

The customer may complain that the tuner sensitivity has become poor, which is cured by replacing the tuner pack. At a time subsequent to the repair, the customer complains that the sensitivity has become poor again.

**Solution:** Replace the tuner pack. Prevent recurring damage to the tuner pack by adding a discharge gap across the antenna input lead and ground.

REF	DESCRIPTION	PART NUMBER
-	DISCHARGE GAP	1-519-504-11

Example shown is for XR-4400; other models are similar.



