

**SONY.**

Hi-Fi Products  
**Service Bulletin**

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** TC-K55/K61/K75/K81/U60/U70

**No.** 35

**Subject:** Capstan Motor Replacement


**Date:** September 19, 1988

**Symptom:**  
(61)

After installing a new Capstan Motor (which includes the Servo PCB), the motor does not start rotating.

**Cause:** A jumper connection on the Servo PCB is missing.

**Solution:** Bridge the solder pads on Pin 6 at IC-1001 as shown below:

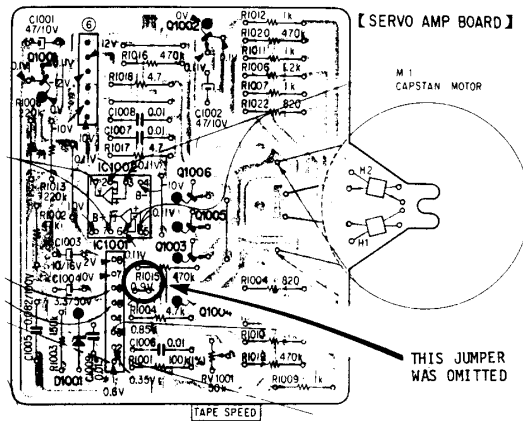

Tape Deck  
CSA-13

Reference: S/B Sony Europe TC-00688

PRINTED IN U.S.A.  
CSA-13888-6