

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-C70/C7ESD

No. 46

Subject: Malfunction of Program Play

Date: November 22, 1988

Symptom:
(22)


1. When selections have been programmed from more than one disc, the next selection on the disc, after the first disc is finished, is not played.
2. When programming more than 10 selections, the unit goes into pause between the 9th and the 10th selections.

Solution: Replace IC301 with the new type.

	Ref. No.	Part Name	Part Number
Former	IC301	HD6301YOE75P	8-759-320-50
New		HD6301YOG31P	8-759-321-16

Note:

1. For CDP-C7ESD (U) Serial No. 800,001-803,000
CDP-C70 (U) Serial No. 800,001-812,000
replace IC301 with new type.
2. For CDP-C7ESD (U) Serial No. 803,001-803,500
remove AMS board and replace IC301 with new type.

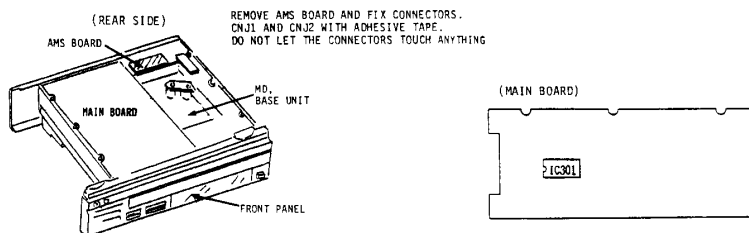

The new IC has already been used for the following sets:

- (1) CDP-C7ESD (U) Serial No. 803,501 and later.
- (2) CDP-C70 (U) Serial No. 812,001 and later.

Reference:

PRINTED IN U.S.A.
CSA-131188-6

Compact Disc
CSA-13