

**SONY**

Hi-Fi Products  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** SRS-55

**No.** 47

**Subject:** Hum Is Heard


**Date:** November 22, 1988

**Symptom:**  
(54)

Hum is heard due to a ground loop in the PCB layout.

**Solution:** Please cut the traces and jumpers as shown. A resistor must be added between pins 5 and 10 after the trace under the IC is cut.

Designation	Description	Part Number
R26	2.2Ω	1-249-385-11

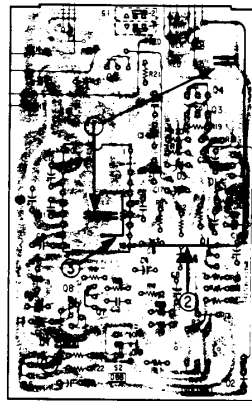

CSA-13 Speakers

Reference: Tech News DS088-0048

PRINTED IN U.S.A.  
CSA-131188-7