

**SONY**

Hi-Fi Products  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** SB-V700

**No.** 58

**Subject:** Distorted Audio

**Date:** January 2, 1989

**Symptom:**  
(53)

Audio distortion may be heard with CD input because the output is clipped.

**Solution:**

To increase the possible dynamic range from 1.5V RMS to 2.0V RMS, change the negative 5V regulator to a negative 6V regulator.

Designation	Description	Part Number
IC803	IC NJM79M06A	8-759-700-21

Miscellaneous

CSA-13

Reference: TN-BET-880110-D

PRINTED IN U.S.A.  
CSA-131288-7