

**SONY**

Hi-Fi Products  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** D-15

**No.** 65

**Subject:** The Enter/Remain Does Not Work

**Date:** April 7, 1989

**Symptom:**  
(22)

The Enter/Remain switch does not work or operates intermittently.

**Solution:**

Please replace the microprocessor with the new one listed below:

Ref. No.	Description	Former		New	
		Type	Part Number	Type	Part Number
IC801	System Control	CX-5086-027Q	8-752-804-33	CX-5086-047Q	8-752-808-85
		CX-5086-033Q	8-752-805-66		

Compact Disc

CSA-13

Reference:

PRINTED IN U.S.A.  
CSA-13389-1