

**SONY**

Hi-Fi Products  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** RM-P700

**No. 91**

**Subject:** Unit Will Not Learn

**Date:** November 3, 1989


**Symptom:**  
(22)

The functions from other remote commanders are not learned, i.e. the indicator does not change from ready to learned during learning.

**Cause:** The detector circuit does not receive any signal. Chip jumper J21, which connects the collector of Q6 and pin 4 of IC6, may have broken down due to the stress exerted by the board holder's boss.

**Note:** J21 has not been indicated on the board. Refer to the figure below for its location.

- Solution:**
1. Remove J21 and connect the two points with a wire.
  2. Cut away the board holder's boss.

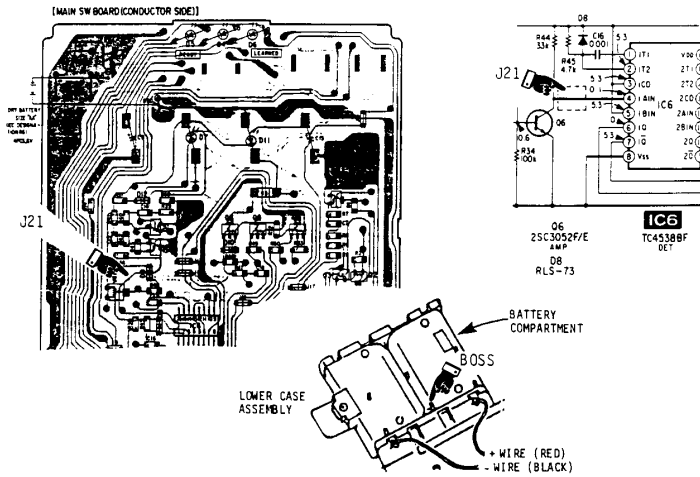

CSA-13 Miscellaneous