

**SONY**

Hi-Fi Products  
**Service Bulletin**

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDP-S107

**No. 100**


**Subject:** Mechanical Noise When Disc Rotates    **Date:** February 2, 1990

**Symptom:**  
(64)

A mechanical noise can be heard while the disc is spinning.

**Cause:** Due to some play between the arm shaft and the chucking arm, these two parts may intermittently touch.

**Solution:** Install a cushion on the upper side of the chucking arm as shown below.

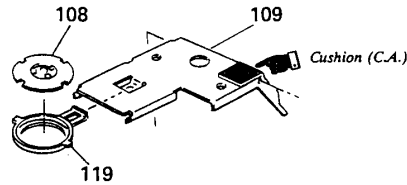

| DESCRIPTION    | PART NUMBER  |
|----------------|--------------|
| Cushion (C.A.) | 4-919-889-01 |

Reference: S/B DA-01789

PRINTED IN U.S.A.  
CSA-13190-1

CSA-13 Compact Disc