

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-VX5

No. 109R1

Subject: Coil Data For T901 and T902

Date: February 8, 1991


This Service Bulletin Supersedes Service Bulletin No. 109

Symptom:
(**)

The service manual lists the part number for the iron core of these two transformers. They are not available wound. They must be wound by hand.

Solution: The number of turns of wire and the gauge is listed below:

Wire Number	Turns	Description
P-3	5T	Polyurethane 0.40mm Diameter
P-4	1T	(Green) AWG28
P-5	2T	(Red) AWG28
P-6	2T	(White) AWG28
P-7	1T	(White) AWG22
P-8	2T	(Red) AWG24

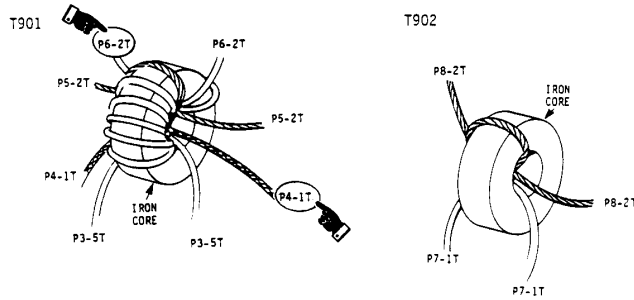

Reference: Fax A891487

PRINTED IN U.S.A.
CSA-13191-6

Receiver
CSA-13