

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company Technical Services
 A Division of Sony Corporation of America
 Sony Drive, Park Ridge, New Jersey 07656

Model: TA-E1000ESD

No.113

Subject: Clicking Noise Is Heard When Changing Inputs (Sources)

Date: March 22, 1990


Symptom:
 (54)

If the customer complains of hearing clicking noise through the speakers when changing inputs, perform the changes listed below. This is caused by mismatched muting transistors.

Solution: Replace the muting transistors (Q801/804-808) which are now 2SC3622 and 2SC2878B, and swap the collector and emitter leads when installing the 2SC2878B.



Ref. No.	Description		Part Number	
	Former	New	Former	New
Q801/804-808	Transistor 2SC3622	Transistor 2SC2878B	8-729-107-91	8-729-201-05

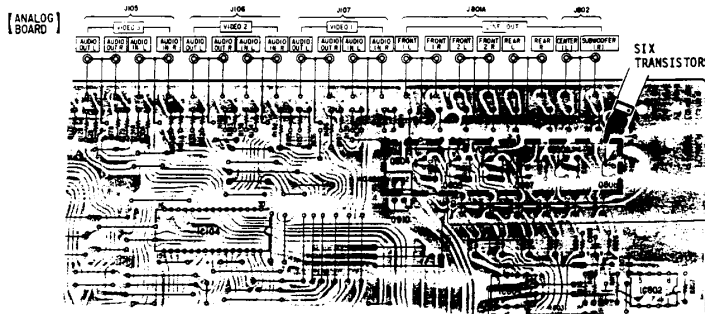

(Continued)

Reference:

PRINTED IN U.S.A.
 CSA-13390-1

CSA-13 Pre - Amplifier

