

**SONY**

Hi-Fi Products  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDP-X77ES

**No. 119**

**Subject:** Replacement of Master Control  
IC (IC801)

**Date:** April 26, 1990

**Symptom:**  
(822)

Unit pauses after playing the first track. The PLAY indicator stays illuminated, but the TRACK and TIME displays do not change.

Units brought in may not exhibit this symptom at first, but it is possible to reproduce it.

1. Insert a disc and make a custom file in the program bank.
2. With the unit in the PROGRAM PLAY mode, press the OPEN/CLOSE button. Change the CONTINUE mode, while the drawer is opening.
3. Play back the disc which was programmed in Step 1. The symptom should appear.

This condition will remain unless the mode is changed to CONTINUE while the disc is playing.

**Solution:** Replace the master control IC (IC801) with the new type.

Description		Part Number	
Former	New	Former	New
CXP-5058H-561Q	CXP-5058H-654Q	8-752-812-22	8-752-814-75

Reference: T/N AU90011

PRINTED IN U.S.A.  
CSA-13490-2

Compact Disc  
CSA-13