

**SONY**

Hi-Fi Products  
**Service Bulletin**

Sony Service Company Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** SEN-190 (HST-190)

**No. 120**

**Subject:** No Sound or Oscillation During  
Tape Playback

**Date:** April 26, 1990

**Symptom:**  
(351)


The amplifier goes into oscillation, resulting in no sound. The playback conditions are as follows:

Playback: Deck B  
Dolby : Off  
Tape Pos: Type I  
Main Vol: Max  
EQ : All Max

**Cause:** The power amplifier output wires are too close to the Playback amplifier portion of Deck B, causing inductive coupling.

**Solution:** Reroute the wires so that they are as far away from this position of the PCB as possible.

ARRANGE HARNESS AS INDICATED

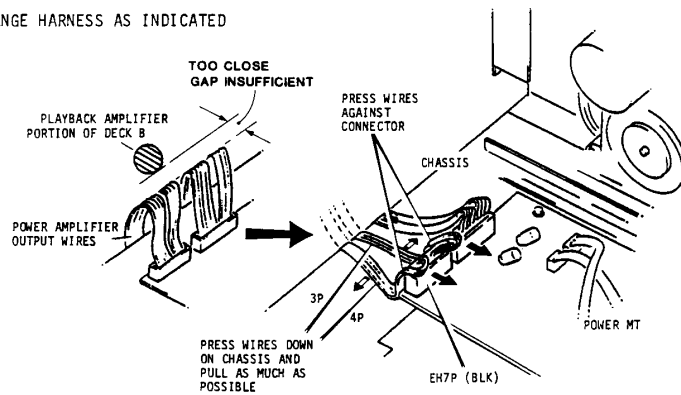

APPLICABLE SERIAL No.'s 800,001-842,500

Reference: T/N AU90010

PRINTED IN U.S.A.  
CSA-13490-3

Compact System  
**CSA-13**