

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-GX5ESI I

No. 124

Subject: Static Noise Heard Through
The Speakers


Date: May 16, 1990

Symptom:
(54)

Noise is generated with the volume knob in the center position.

Solution: Move muting transistor from muting board to display board. This eliminates the connecting cables, and eliminates the noise, as the noise is radiated by the display board and picked up by the cables.

- o Muting Board
 - Remove Muting Transistor Q307
 - Bridge the Base and the Collector.
- o Display board
 - Cut the pattern directly behind Pin 4 of Connector CNP301
 - Install Muting Transistor Q307 on the Conductor side as shown.

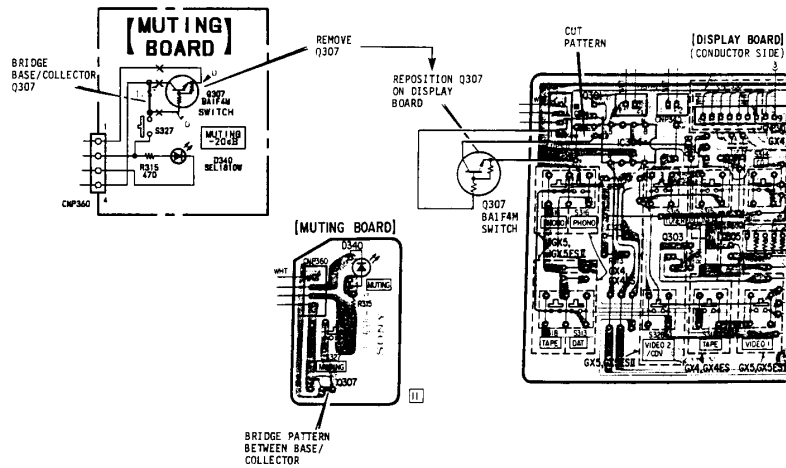

Reference: HF00890

PRINTED IN U.S.A.
CSA-13490-7

Receiver
CSA-13