

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: D-9

No. 130

Subject: Disc Spins Backwards

Date: August 31, 1990

Symptom:
(62)

Disc will immediately spin backwards when play is attempted.

Solution: Capacitor C534, which couples FSW signal to IC502, is leaky, affecting CLV Servo Filter. Replace C533 and C534, if necessary.

Portable Compact Disc

CSA-13

Reference: FPR-L0681
Autoflagging: (YES)

PRINTED IN U.S.A.
CSA-13890-3