

SONY.

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: D-35

No. 149

Subject: Battery Pack BP-5 Cannot Be Fully Charged


Date: December 10, 1990

Symptom:
(22)

The repetitive charging and discharging of BP-5 causes insufficient charging ability.

Solution: If this symptom occurs, replace the following resistors:

Description			
Ref. No.	Former	New	Part Number
R418	330 Ohm	560 Ohm	1-216-192-00
R419	330 Ohm	560 Ohm	1-216-192-00
R420	330 Ohm	560 Ohm	1-216-192-00
R414	47 Ohm	150 Ohm	1-216-029-00
R404	3.0k Ohm	6.8k Ohm	1-216-671-11

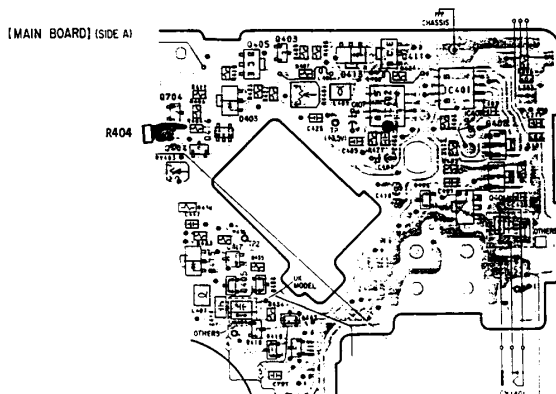

(Continued)

Reference:

PRINTED IN U.S.A.
CSA-131290-2

Compact Disc
CSA-13

