

**SONY.**

Hi-Fi Products  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-AV910/1010

No. 150

Subject: Missing Adjustment Procedures For Amp Bias Current      Date: December 10, 1990

Symptom:  
(\*\*)

The adjustment procedures for the Amp Bias Current are not listed in the service manual.

Solution: Please update your service manual with the adjustment procedures listed below:

**AMP SECTION**

**DC Bias Adjustment**

- Perform this adjustment after replacement of power amp or drive circuit transistors.

**Setting:**

VOLUME: 0  
SPEAKERS: OFF (no load)

**Procedures:**


- Connect the digital voltmeter to Bias Check Point ( L : L-CH, R : R-CH)
- Increase the AC power voltage gradually to 120 V confirming that the voltmeter will not indicate an abnormal value.

- Confirm that the display is normal.
- Adjust RT701 (L-ch) or RT751 (R-ch) so that the reading on the voltmeter becomes 0.1 mV within 30 seconds after the power turned on.

Note: It is normal that the voltage will increase as time passes.

- Turn the power off and remove the digital voltmeter.

(MAIN BOARD) (Conductor side)

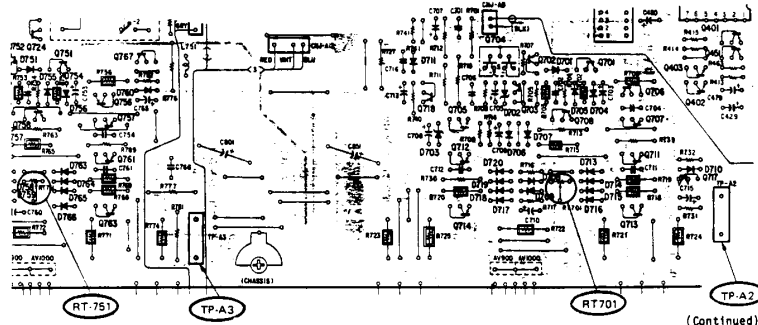

(Continued)

Reference: L1158

PRINTED IN U.S.A.  
CSA-131290-3

Receiver  
CSA-13

AMP SECTION

