

SONY.

Hi-Fi Products
Service Bulletin

Sony Service Company · Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: TC-RX70ES

No. 151

Subject: Unit Causes Tape Damage

Date: December 10, 1990


Symptom:
(63)

Tape damage occurs because the pinch roller is held pressed against the capstan shaft due to the head base failing to go down when the unit is turned Off.

Cause: The values of D808 and D809 are too HIGH, causing an immediate stop of the motor.

Solution: If this symptom occurs, replace Zener Diodes D808 and D809 with HZS9A2L as follows:

Ref. No.	Description	Part Number
D808, D809	HZS9A2L	8-719-933-54

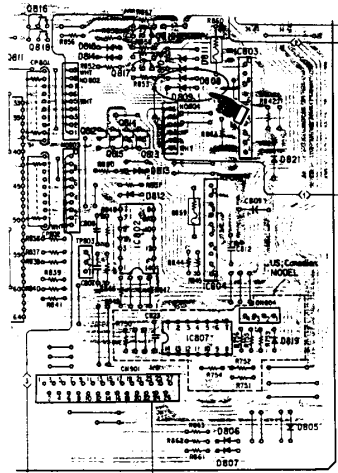

Reference: AU90036

PRINTED IN U.S.A.
CSA-131290-4

CSA-13
Tape Deck