

**SONY**

Hi-Fi Products  
**Service Bulletin**

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** TC-K620/K650ES

**No.156**

**Subject:** Capstan Motor Misoperation

**Date:** December 26, 1990


**Symptom:**  
(162)

The capstan motor continues to rotate slowly and the cassette holder LED lights dimly after the power has been switched off.

**Cause:** The problem is due to the unstable switching of Q807.

**Solution:** If this symptom occurs, replace R816 as listed below:

Ref. No.	Description		Part Number
	Former	New	
R816	22k Ohm	4.7k Ohm	1-249-425-11

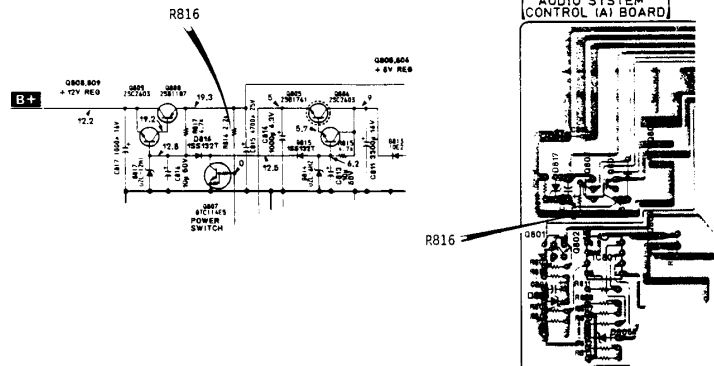

Reference:

PRINTED IN U.S.A.  
CSA-131290-5

CSA-13  
Tape Deck