

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-C75ES/C85ES

No.164

Subject: Disc Table Will Not Rotate or
Drawer Does Not Open

Date: January 30, 1991

Symptom:
(61)

The "BD" Board contacts the player base causing disc table operation malfunction. This problem is caused by the metal player base warping upward and contacting the "BD" Board when the "BD" Board drops to allow the disc table to revolve. Since the optics does not drop all the way down, it jams the disc platter.

Solution: If this symptom occurs, remove the metal base and adjust it back to its original shape. If adjusting the base does not solve the problem, remove the rubber pad from the bottom of the bracket assembly. Attach black electrical tape to the metal base where the "BD" Board would contact the metal.

Compact Disc
CSA-13

