

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-GX5ES11

No. 175


Subject: Shorted Traces On Replacement
Power Board

Date: March 29, 1991

Symptom:
(**)

Power relay will chatter continuously.

Solution: If this symptom occurs, cut the foil trace on the "PC" Board
(power supply) where CN-802/Pin 4, and C817 and C819 are
located.

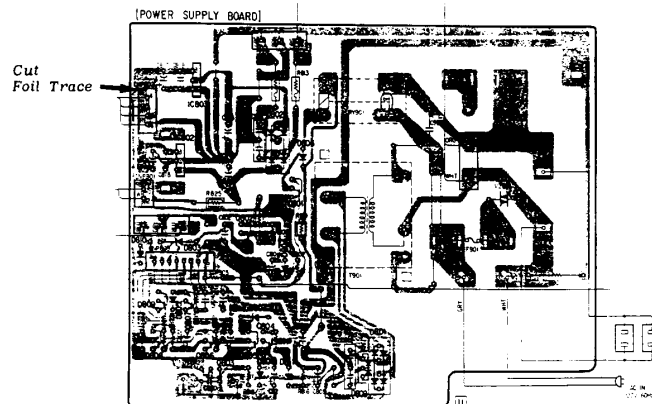

Reference: FPR M0533

PRINTED IN U.S.A.
CSA-13391-3

Receiver
CSA-13