

# SONY

## Hi-Fi Products Service Bulletin

Sony Service Company Technical Services  
A Division of Sony Corporation of America  
Sony Drive Park Ridge, New Jersey 07656

**Model:** ST-818M/-H300/-H500

**No. 188**

**Subject:** Beat Noise On Tuner


**Date:** April 19, 1991

**Symptom:**  
(54)

When listening to the system at a low level, background noise can be heard.

**Solution:** The problem is due to insufficient ground. To solve this problem, (remove C89 if present in the unit) and place a 100uf 10v capacitor across pins 5(+) and 8(-) of connector CNJ1.

Description	Part Number
100uf, 10V Capacitor	1-124-443-00

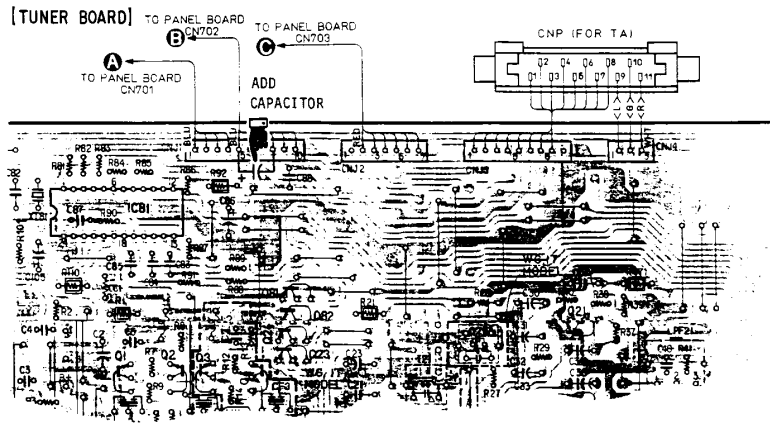

CSA-13 Tuner