

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: TA-N80ES

No. 200


Subject: Noise in Output

Date: July 29, 1991

Symptom:
(54)

A 3-4 KHz ticking or oscillation noise in the audio. This is due to C107 incorrectly mounted on the balance amp board. The serial numbers affected, range between 4500001 and 4501000.

Solution: Reverse the polarity of C107.

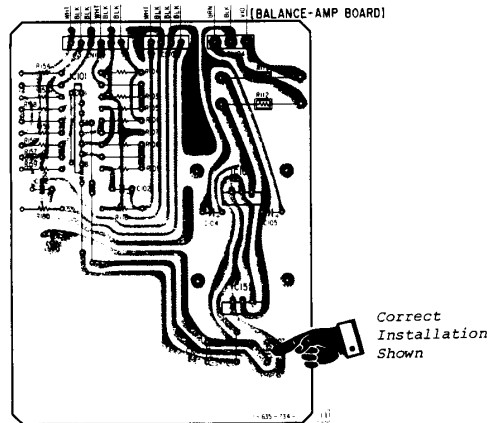

CSA-13 Amplifier