

**SONY**

Hi-Fi Products  
Service Bulletin

**Sony Service Company** Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey, 07656

**Model:** TC-K950ES

**No.** 212

**Subject:** Record Level Decreases

**Date:** September 20, 1991

**Symptom:**  
(52)

When recording on the 'B' side of a tape after recording on the 'A' side, the level of the 'A' side's high frequencies decrease. The problem is caused by excessive erase current.

**Solution:**

Change R547 to the new value listed below in order to decrease the erase head current.

REF.	FORMER		NEW	
	DESCRIPTION	PART NO.	DESCRIPTION	PART NO.
R547	CARBON 4.7K	1-249-425-11	CARBON 3K	1-247-842-11

CSA-13 Tape Deck