

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive Park Ridge New Jersey 07656

Model: MHC-3600, TA-H3600

No. 223

Subject: Mechanical Buzzing Noise

Date: November 14, 1991

Symptom:
(64)

A buzzing noise is audible from the set. The problem is caused by vibration of the Mu-Metal Plate located between the power transformer (Ref. T1) and the power amp board (Ref. 23) shown on page 28 in the Service Manual.

Solution:

To solve the problem, attach the Mu-Metal Plate to the transparent insulation sheet by using double-sided adhesive tape or by gluing them together using Sony Bond (P/N 7-432-916-01).

