

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: TC-H3600

No. 224R1

Subject: Unit Contains Fuse Links On Power Board Which
Are Not Referenced in the Service Manual.

Date: June 10, 1992

This bulletin supersedes Hi-Fi Products Service Bulletin No.224.


Symptom:
(**)

The unit has (2) 2.5A fuse links, the first connected in series with the collector of Q501 and the bridge rectifier and the second connected in series with the collector of Q502 and the bridge rectifier. The Service Manual does not reference these parts.

Solution: The correct part number and schematic location of the fuse link described above are shown below:

DESCRIPTION	PART NUMBER
FUSE, MICRO (2.5A, 125V)	1-532-780-21

[POWER BOARD]

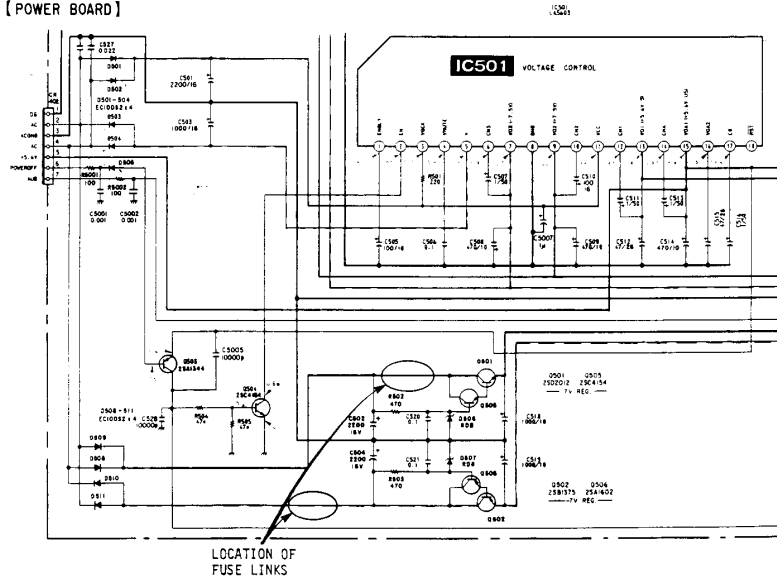

Reference: FPR M2671

PRINTED IN U.S.A.
CSA-13592-4

CSA-13
Tape Deck