

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive Park Ridge, New Jersey 07656

Model: STR-AV570/AV270/AV23

No. 227R2

Subject: Unit Turns On And Off By Itself And The Surround Light Blinks.

Date: February 10, 1993

This bulletin supersedes Hi-Fi Products Service Bulletin No. 227R1

Symptom:
(13)


The unit will turn on and off by itself intermittently and the SURROUND indicator blinks.

Solution:

The ground connection coming from the Display board (Ref. 10) connected to the heat sink is loose. Improve the ground connection from the Display board by soldering the ground lug to the chassis using a high wattage soldering iron. Solder the ground lug to the chassis at the point indicated in the diagram below. It is also necessary to tighten the ground screws securing the heat sink on both sides. Reset the display processor (IC301) by depressing and holding front panel buttons 4, 5 and 6 and powering the unit on. Reset is confirmed in the display by (4) dashes.

Receiver
CSA-13

(1) FRONT PANEL ASSEMBLY SECTION

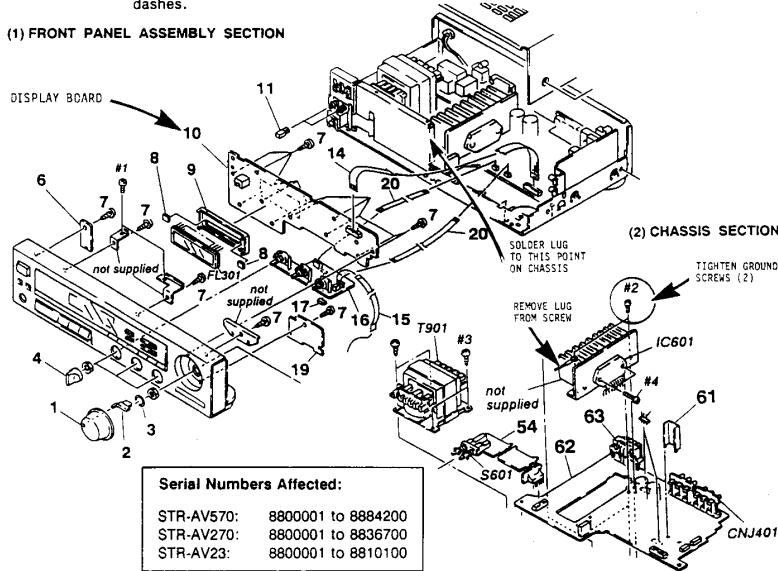

Reference: FPR-M2570
AutoFlagged (YES)

PRINTED IN U.S.A.
CSA-13193-8