

**SONY**

Hi-Fi Products  
Service Bulletin

Sony Service Company Technical Services  
a Division of Sony Corporation of America  
Sony Drive Park Ridge New Jersey 07656

**Model:** STR-GX57ES/GX67ES

**No. 233**

**Subject:** Unit Goes Into Protection With High Volume  
On Rear Amp


**Date:** December 31, 1991

**Symptom:**  
(12) Setting the rear amp volume too high causes the protection circuit to activate.

- Solution:**
1. Replace C714 from a 0.1 $\mu$ F to a 2.2 $\mu$ F.
  2. Replace jumper JW616 with a 330K ohms resistor.

REF. NO.	DESCRIPTION	PART NUMBER	
		ORIGINAL	NEW
C714	0.1 $\mu$ F	2.2 $\mu$ F	1-124-925-11
JW 616	JUMPER	RESISTOR, 330K ohms	1-246-533-00

3. Remove C606 and C656.

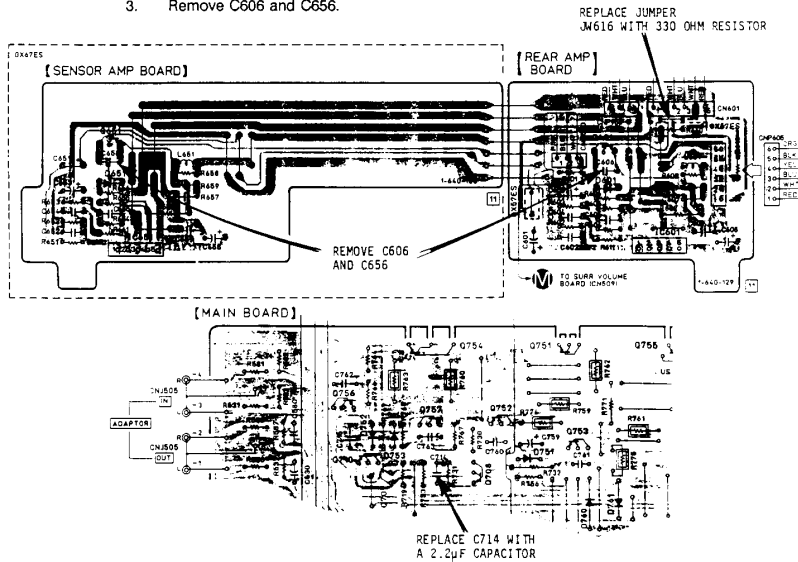

**CSA-13** Receiver

Reference: FPR #M2972

PRINTED IN U.S.A.  
CSA-131291-2