

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-GX57ES/GX67ES/AV970X/AV1070X

No. 234

Subject: Pop Noise In Dolby Mode


Date: December 31, 1991

Symptom:
(54)

When the unit is in the Dolby mode with a Dolby source, and the volume control is turned up to at least 50%, there is an intermittent pop noise heard in the rear speakers.

Solution: If this symptom occurs, replace IC308 with the SSM-2126P version.

REF. NO.	DESCRIPTION		PART NUMBER
	FORMER	NEW	
IC308	SSM-2125	SSM-2126	8-759-512-93

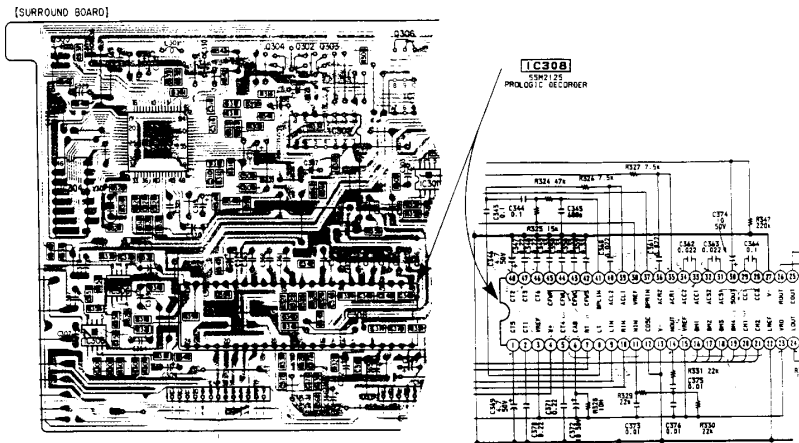

CSA-13 Receiver

Reference: FPR #M2971

PRINTED IN U.S.A.
CSA-131291-3