

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-C910/C90ES

No. 245

Subject: Disc Stops Between Magazine and MD Mechanism

Date: January 27, 1992


Symptom:
(62)

The disc stops between the magazine and the MD Mechanism due to flat Cable 5P which breaks. Cable 5P, which connects CN603 of M2 Motor Board and CN611 of the relay board passes under the relay board and breaks.

Applicable Serial Numbers
CDP-C910 up to 813780
CDP-C90ES up to 803200

Solution: Replace flat Cable 5P with the new type (P/N shown below) and connect it after bending as shown below:

| DESCRIPTION | PART NUMBER |
|---------------|--------------|
| 5p FLAT CABLE | 1-690-115-11 |

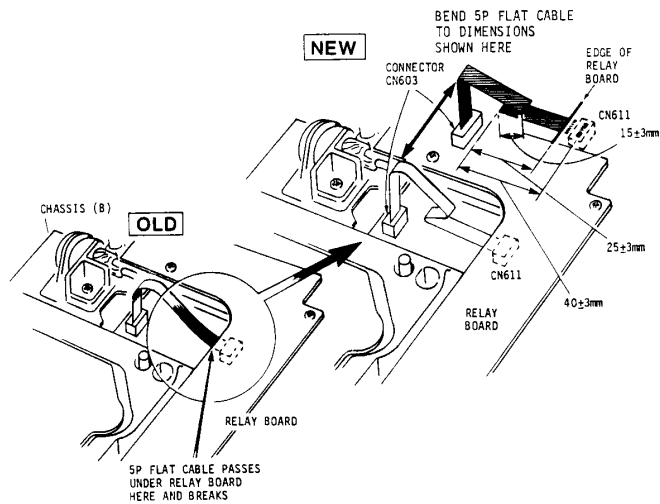

CSA-13 Compact Disc

Reference: Tokyo Technical News AU91019

PRINTED IN U.S.A.
CSA13192-7