

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-GX57ES/67ES

No. 249

Subject: Unit Goes Into Protect When Playing For A Couple
Of Hours After Initial Turn-On

Date: February 28, 1992


Symptom:
(51)

Capacitor C977 is mounted incorrectly on the Main PCB. The capacitor symbol silk screened on the Main PCB for capacitor C977 is shown in reverse polarity. The capacitor is installed in accordance with the silk screen. The Service Manual schematic shows the correct polarity but the PCB layout shows incorrect polarity.

S/N's of units affected: STR-GX57ES; 800001 to 806000
STR-GX67ES; 800001 to 808100

Solution: Replace C977 on units with S/N's which fall into the range shown above. Install the new capacitor opposite to the polarity shown on the PCB silk screen.

REFERENCE	DESCRIPTION	PART NUMBER
C977	CAPACITOR, 47 μ f @ 25V	1-124-477-11

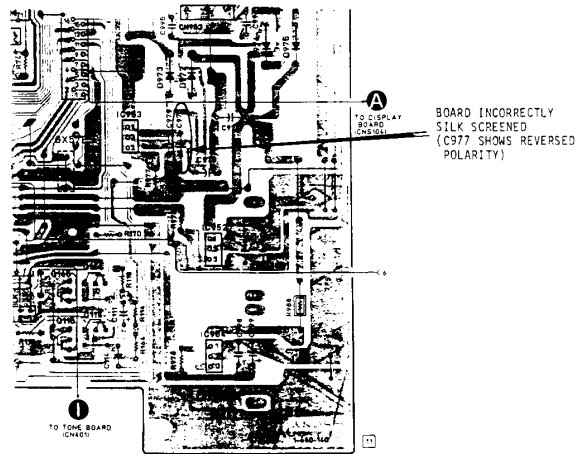

Reference: FPR M2949
Autoflagging: (YES)

PRINTED IN U.S.A.
CSA-13292-1

Receiver
CSA-13