

SONY.

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: TA-AX311/AV411

No. 253

Subject: Display Failure

Date: March 20, 1992



Symptom:
(13)

The unit is functional, but the display does not light. Q951, R955 and D957 should be tested for proper functionality. In most cases, Q951 will develop a problem from being over-driven and will sometimes cause R955 and/or D957 to develop a problem.

Solution: Check R955 & D957 and replace with parts listed in the Service Manual if necessary. Replace Q951 with the part number shown in the chart below:

REFERENCE	DESCRIPTION		PART NUMBER	
	FORMER	NEW	FORMER	NEW
Q951	2SA-733	2SB-1375	8-729-141-03	8-729-209-60

NOTE: Be sure to follow the correct orientation of the new component when installing.

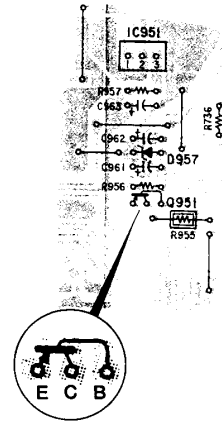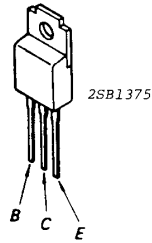

CSA-13 Integrated Amp.