

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: MDR-IF5K

No. 254

Subject: Charged Battery Does Not Last


Date: March 20, 1992

Symptom:
(11)

The battery only lasts two hours after repeated 3 hours quick charge.

Solution: Replace the chip resistors on TX Board with the following:

REFERENCE	DESCRIPTION		PART NUMBER
	FORMER	NEW	
R46	150 OHMS	100 OHMS	1-216-174-00
R47	100 OHMS	0 OHMS	1-216-296-00
R48	3.9 OHMS	1.5K	1-216-202-00

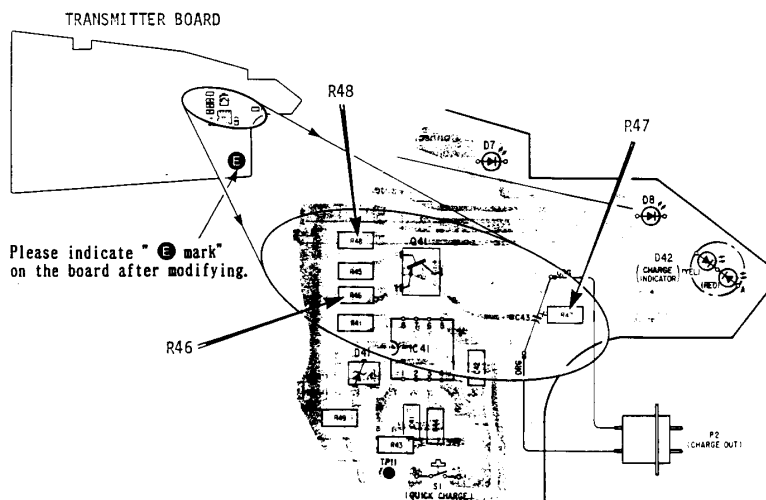

Reference: GA-92003
Autoflagging: (YES)

PRINTED IN U.S.A.
CSA-13392-2

CSA-13 Accessories