

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: MHC-1600, HCD-H1600

No. 255R1

Subject: Wrong Display/No System Power

Date: August 3, 1992


THIS SERVICE BULLETIN SUPERSEDES SERVICE BULLETIN NO. 255

Symptom:
(13)

1. Wrong display (ex. "KARAOKE" will appear in the display or receiving frequency on the tuner will not be indicated properly).
2. System power will not be turned on.

Solution: Change the value of C370 on the panel board from 0.056 F to 0.1 F.

REF.	DESCRIPTION		PART NUMBER
	FORMER	NEW	
C-370	0.056 F	0.1 F	1-163-038-00

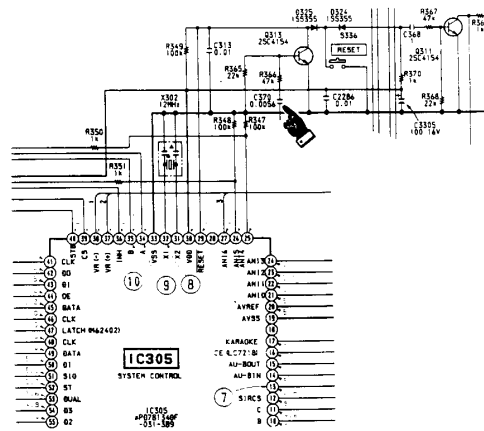

Compact System
CSA-13