

SONY.

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656


Model: CDP-67ES/C615

No. 260

Subject: Right Hand Side Segments of Display Light, Even When
The Power Is Off **Date:** March 20, 1992

Symptom:
(13) Right hand side segments of the display light, even when the power is off.

- Solution:** Perform the following modification:
1. Cut pattern off FL501 / pin 40 and 41 in the Display Board as shown.
 2. Cut pattern off power switch S560 in the power SW Board as shown.
 3. Add wire from power switch S560 to FL501 / Pin 41 as shown.
 4. Add wire from power switch S560 to pattern as shown.

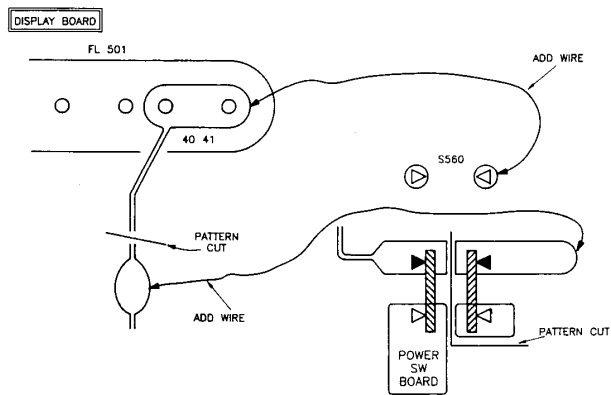

Reference: FPR N0489

PRINTED IN U.S.A.
CSA-13392-8

CSA-13 CD Player