

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company Technical Service
A Division of Sony Corporation of America
Sony Drive Park Ridge, New Jersey 07656


Model: TAN-611

No. 263

Subject: Unit Goes Into Protect Immediately Following Power-up. **Date:** April 27, 1992

Symptom:
(51) When unit is powered on, the speaker relay turns on and audio is heard from the front speakers for a brief instant before the unit goes into protect.

Solution: The problem is due to broken solder connections on IC601 and IC602. This is caused by excessive movement between the PC board and mounted components IC601 and IC602. Remove IC601 and IC602 and provide strain relief by bending leads as shown in diagram below. If the leads are too short, replace IC601 and IC602 with new parts and bend leads as shown in diagram.

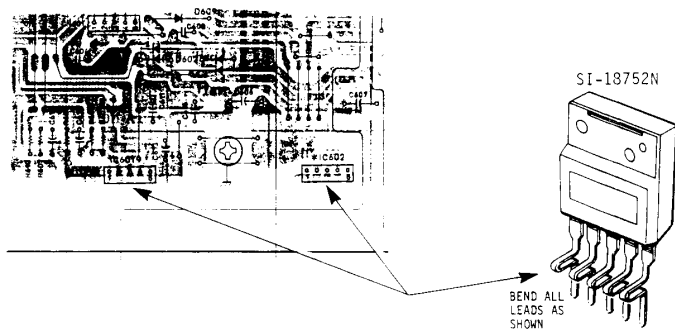

REF. NO.	DESCRIPTION	PART NUMBER
IC601/602	SI-18752N REAR CHANNEL AMPLIFIER IC	8-759-502-32

Reference: FPR-N0386
Autoflagging - Yes

PRINTED IN U.S.A.
CSA-13492-2

CSA-13 Integrated Amp.