

**SONY**

Hi-Fi Products  
**Service Bulletin**

Sony Service Company Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** TA-AV411


**No. 264**

**Subject:** Unit In Protection

**Date:** May 4, 1992

**Symptom:**  
(51) Unit in protection after tightening all ground screws.

**Solution:** The screw which secures J501 to the rear panel (CD and PHONO input jack) breaks the solder joint between J501 and the PCB when tightened. Add a ground wire as shown in the diagram below.

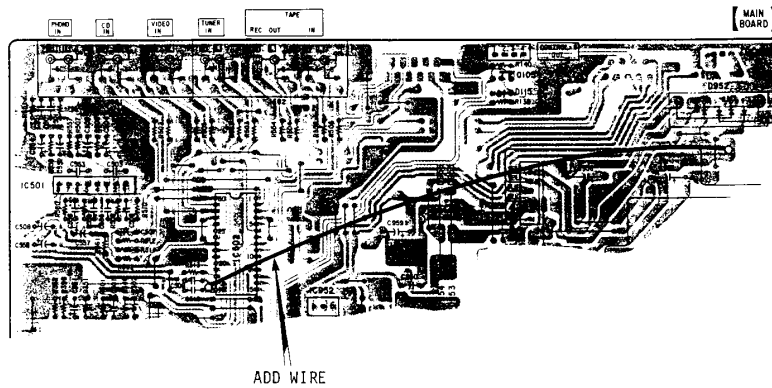

CSA-13 Integrated Amp.