

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: MHC-2600/3600, ST-H3600

No. 267



Subject: Clock Accuracy

Date: May 29, 1992

Symptom: (23) The clock is too slow and loses some seconds each day.

Solution: Change the value of C706 and C707 on the display board according to the following table:

REF. NO.	DESCRIPTION		PART NUMBER
	FORMER	NEW	
C706/707	15pF/50V	5.6 pF/50V	1-162-196-31

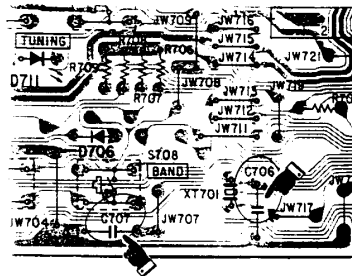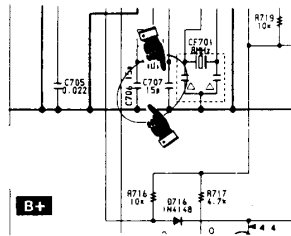

Miscellaneous
CSA-13