

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-AV23/270X/370X/570X

No. 281

Subject: Preventing Damage To Display Board When Changing CPU IC301.



Date: August 3, 1992

Symptom:
(**)

The glue which secures the CPU IC301 to the display board may make it difficult to remove without damaging the board.

Solution:

Unsolder each pin of the IC individually, using a soldering iron and a tool such as a dental pick. Then heat the IC with a hot air tool, such as the Weller Model WST2 PyroPen, until the glue melts, allowing the IC to be easily removed.

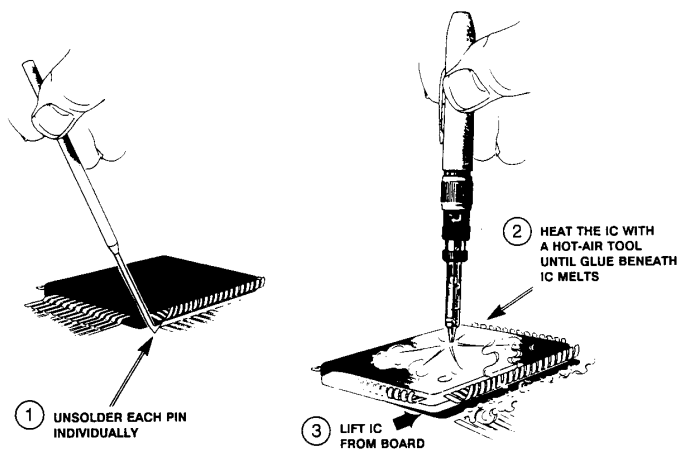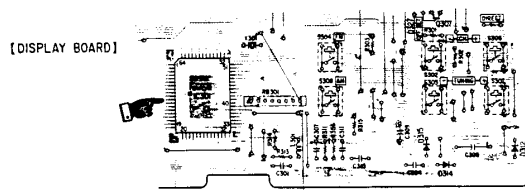

Reference: FPR N0816

PRINTED IN U.S.A.
CSA-13792-3

CSA-13 Receiver