

SONY

Hi-Fi Products Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-X779ES

No. 288

Subject: Balanced Outputs in Reverse Phase

Date: August 14, 1992


Symptom:
(54)

The phase on the balanced outputs is in reverse due to incorrectly installed connectors. CN501 and CN401 on the audio board have been mounted in reverse.

Applicable Serial Numbers: Up to 800,200

Solution:

Remove CN501 (RED) and CN401 (BEIGE) from the audio board and install them in reverse order (see drawing below):

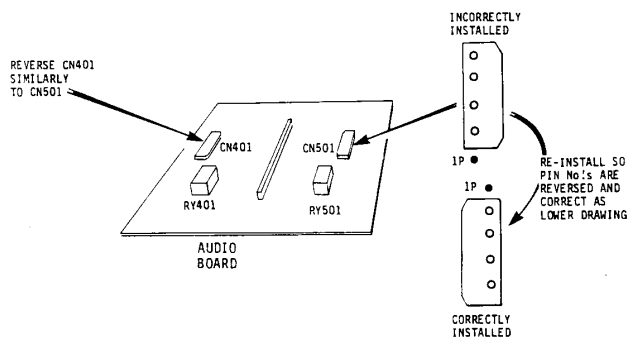

CSA-13 CD Player