

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: D-4140/T4/T40

No. 289

Subject: Caution When Replacing IC801

Date: August 14, 1992

Symptom:
(**)

If you change IC801


	DESCRIPTION	PART NUMBER
FORMER IC	CXP-5086-026Q	8-752-804-07
NEW IC	CXP-5086-602Q	8-752-809-23

Solution:

Perform the following:

1. Remove D808 and D809 and then short the lands for those diodes.
2. Change the value of C805 and C806 from 68pF to 47pF.

REFERENCE	DESCRIPTION		PART NUMBER
	FORMER	NEW	
C805 & C806	68pF	47pF	1-163-109-00

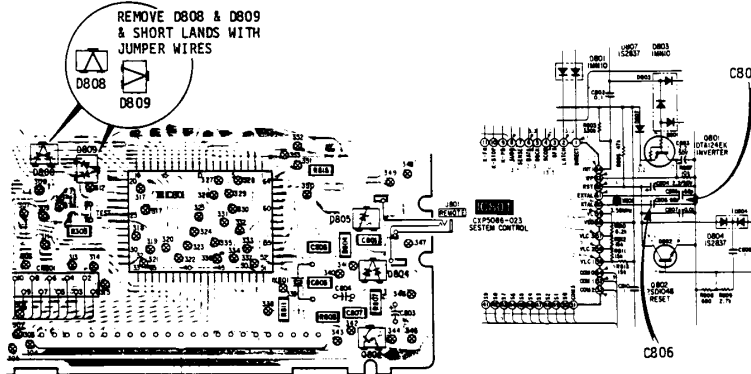

Reference: GA92026

PRINTED IN U.S.A.
CSA-13892-3

CSA-13 Discman