

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-AV910/AV920/AV970X/AV1010/
AV1020/AV1070X

No. 291

Subject: RTA Display Jumps When Changing Volume
Level With Remote Commander


Date: September 17, 1992

Symptom:
(13)

The levels on the RTA display jump when no signal is present and the volume level is changed using the remote commander. Changing the volume level by operating the master volume control manually does not affect the RTA display.

Solution:

Tighten the ground screw located at the front right side of the main PC board (as viewed from the front of the unit).

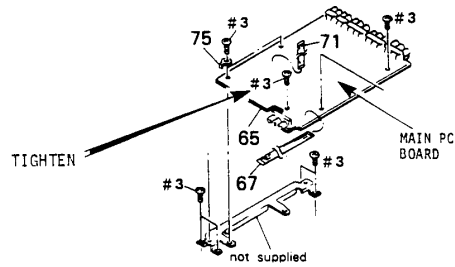

Receiver
CSA-13