

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: HCD-H50

No. 294

Subject: Tuner Preset Memory Retention


Date: October 16, 1992

Symptom:
(22) Memorized tuner presets last only two days without power, instead of one week as described in Instruction Manual.

Applicable Serial Numbers: 800,001 and up

Solution: Change C596 from 0.22F to 1F as shown in the chart below. The value of the capacitor installed during production is insufficient for back-up memory.

REFERENCE	DESCRIPTION	PART NUMBER	
		INCORRECT	CORRECT
C596	DOUBLE LAYERS	1-125-445-11	1-125-447-11

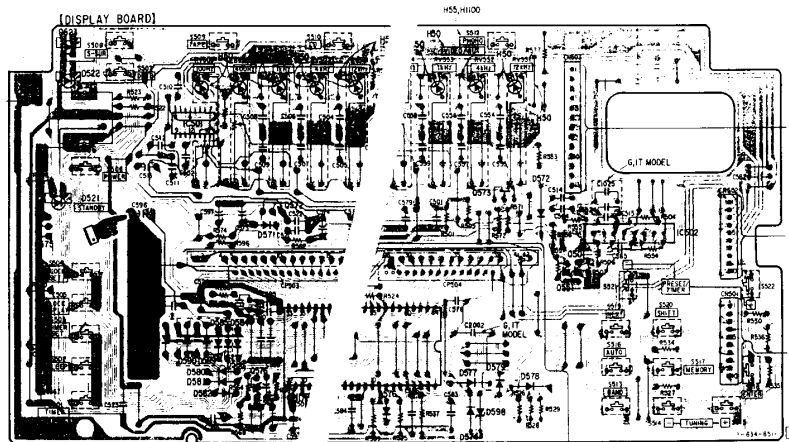

Reference: FPR N1979
Autoflagging: (YBS)

PRINTED IN U.S.A.
CSA-13992-2

CSA-13 Compact Disc