

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-D1090

No. 295

Subject: No Display and No Sound

Date: October 16, 1992


Symptom:
(12)

When operating the unit, there is no display (other than the cursor mode LED) and the sound suddenly cuts out. The set can be reset by turning the power button off and then on.

Applicable Serial Numbers: 800,001 - 802,000

Solution:

Form a solder bridge between Pins 4 and 5 on system control IC150 on the main board. Pin 5 on IC150 is floating (no connection) and is easily influenced by noise. As a result, system control IC150 locks up.

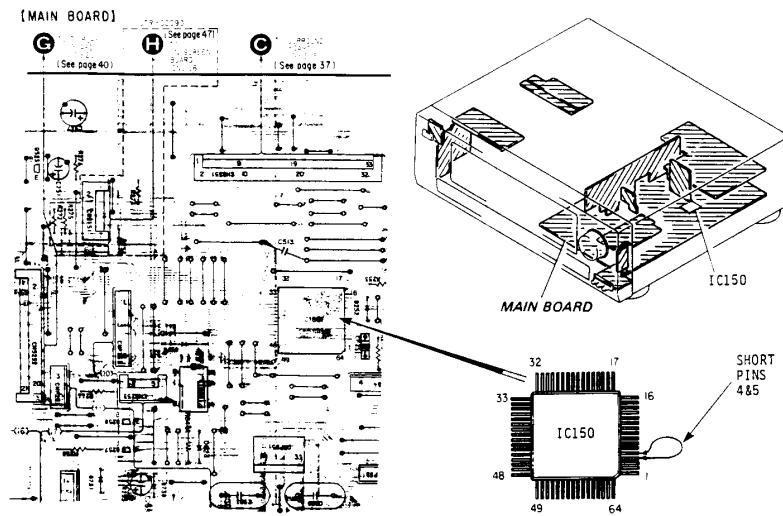

CSA-13 Receiver

Reference: FPR N1963
Autoflagging: (YES)

PRINTED IN U.S.A.
CSA-13992-3