

**SONY**

Hi-Fi Products  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** DTC-57ES

**No. 296**

**Subject:** No FF or REW

**Date:** October 16, 1992


**Symptom:**  
(61)

FF and/or REW is inoperative due to washer (Ref. 367) and sustaining gear neck (Ref. 374) which come off.

**Solution:**

Use the following lever assembly instead of individual lever, gear, etc:

DESCRIPTION	PART NUMBER
LEVER (F/R) ASSY	X-3364-581-1

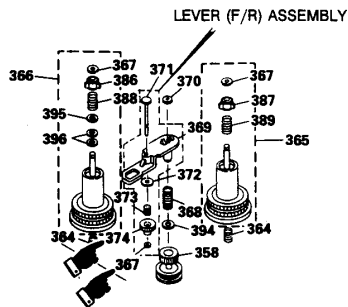

CSA-13 DAT

Reference: FPR N1775

PRINTED IN U.S.A.  
CSA-13992-5